

Material characterisation to understand various modes of corrosion failures in large military vehicles of historical importance

A. Saeed¹, Z. Khan¹, N. Garland¹ & R. Smith²

¹*Sustainable Design Research Centre,
School of Design, Engineering and Computing,
Bournemouth University, UK*

²*The Tank Museum, Bovington, UK*

Abstract

Large military vehicles within museum collections are stored in two distinct environments, controlled and uncontrolled, with an intermittent transitional mode where vehicles travel between the two. Variable environmental conditions combined with operational factors pose significant risks to the reliability, durability and longevity of these vehicles. Although there are methods for retarding or decelerating aspects of failure, to maintain the integrity and originality of these vehicles as artefacts a sustainable methodology for conserving these vehicles should be developed.

Corrosion is one of the significant contributors to the structural damage and material aging of historical military vehicles; therefore an experimental study was conducted to understand the prevailing mechanisms of failures due to corrosion with various types occurring in these vehicles identified. This paper presents various modes of corrosion in historic vehicles while X-ray Fluorescence and ultrasonic scanning corrosion mapping techniques characterise corrosion inhibiting materials and subsequent material loss. Understanding material profiles and their link to environmental exposure during use and non use of these vehicles will lead to a sustainable methodology for their conservation.

Keywords: sustainable, military, vehicle, corrosion, materials, conservation.



1 Introduction

The structural and functional deterioration of the large metal structures due to their environmental exposure and the operating conditions are responsible for their structural aging [1]. Aging mechanisms in large metal structures such as bridges, aircrafts, vehicles etc is recognised as a growing problem [2]. Aging mechanisms such as corrosion, surface and sub surface cracks, wear due to interacting surfaces and undesired stresses are leading to mechanical failures, higher maintenance costs and compromises the structural integrity. Corrosion has been identified as one of the major contributor to the aging mechanisms; it affects all metal structures by deteriorating the material's properties [3].

This research focuses upon the corrosion damage within the large historic vehicles in the museum environment. Corrosion is indiscriminate in affecting metal structures and museum artefacts are no exception. The military vehicles from World War I and II were designed and manufactured according to the automotive technologies in place at those times [4] with only a limited life-expectancy, however their participation in the war and the subsequent historic significance means it is important to devise sustainable methodologies for long-term preservation. Continuous corrosion problems within large historic military vehicles in the museum environment are leading to the concerns of their longevity, in particular where failures in protective measures are also identified [5]. For the purpose of sustainable methods it is important to understand the various corrosion modes, material characterisation and the material loss profile due to corrosion.

For this research military vehicles were inspected for visual signs of corrosion and novel methods such as X-ray fluorescence for elemental identification and ultrasonic scanning for material loss were conducted. Visual inspection identified different modes of corrosion depending on their exposure to extreme environments during the war, operating conditions at the time of their service life, types of materials used and their current working or non-working environments.

X-Ray fluorescence method found Fe, the main constituent; other elements such as W, Mo and Mn were also identified. Ultrasonic methods found severe material loss due to corrosion in the selected samples.

2 Experimental methodologies

The following methods are used in the research. Only the most common and reoccurring types of corrosion which were found on a larger scale in the vehicles are presented here.

2.1 Visual inspection

Visual inspection was completed on more than 20 large military vehicles from the World War I, II and post war era. The investigation found one or more forms of corrosion in the same vehicles. Some widespread and most occurring modes of corrosion are described from four military tanks Table 1.



Table 1: Military tanks presented in this research.

No	Vehicle	Environment	Manufacture	Country of Origin	Era
1	Mark II	Controlled	1917	United Kingdom	WW 1
2	Sherman*	Uncontrolled	1940-1941	United States	WW 2
3	King Tiger	Controlled	1943	Germany	WW 2
4	Centurion	Uncontrolled	1945	United Kingdom	Post war
5	Scorpion	Uncontrolled	1973	United Kingdom	Post War

XRF and Ultrasonic scanning is conducted on Sherman.

2.2 X-ray fluorescence

X-ray fluorescence was conducted on Sherman M4A1 for elemental identification. The test sample was bombarded by an intense x-ray beam resulting in the emission of fluorescent x-rays from the test object. The emitted fluorescent x-rays are then detected by XRF analyser [6] which identifies the elements by measuring the energies of the emitted fluorescent x-rays and counting the number of rays in each energy spectrum [6, 7].

2.3 Ultrasonic scanning

Ultrasonic scanning uses pulse waves from 0.10 to 15.0 MHz frequencies range to measure material loss and other dimensional anomalies in the test objects [8]. This research work presents ultrasonic scanning using pulse echo method where pulses are transmitted and received back on the same side of test object to detect and characterise defects.

3 Results

3.1 Uniform corrosion

With uniform corrosion a direct chemical attack affects the surface of the metal and then spreads out evenly across the entire surface, results are not usually fatal and it is not classified as one of the severe forms [9]. Figure 1 of the King Tiger's flywheel shows uniform corrosion spreading across the surface. Uniform corrosion was also found in Tog II and FT 17 on considerably larger surface areas. Uniform corrosion, if left to continue, could lead to general thinning of the surface and may transform in to another form of corrosion [10].

3.2 Fretting corrosion

Fretting corrosion occurs at the interface of the interacting surfaces which are subject to relative motions. The King Tiger planetary gears (Figure 2) are a classic example of this form. Interacting mechanical wear lead to the removal of material particles, followed by the oxidation of the material debris and the newly exposed surface [11]. The oxidised debris would act as an abrasive media leading to further wear and fatigue failures could occur [9, 12].



Figure 1: King tiger flywheel.



Figure 2: King tiger planetary gears.

3.3 Stress corrosion cracking

Stress corrosion cracking is considered one of the severe types of corrosion, it could cause a partial or complete failure of a structure especially in the presence of dynamic or static loading and initiation of a stress corrosion crack [13]. The Mark-II Tank glacis plate in Figure 3 shows stress corrosion cracking where a crack is initiated and penetrating through the surface with no significant material loss on the surface. Stress corrosion is difficult to detect, hard to predict and unexpected failure can occur [13, 14].

3.4 Inter-granular/exfoliation corrosion

Inter-granular corrosion describes the attack on a metal's or alloy's grains or boundaries [15]. Corrosion products between the grain boundaries exert pressure on the grains and the result is exfoliation corrosion. The Centurion armoured skirt in Figure 4 is an example of exfoliation corrosion leading to lifting or leafing effect. Leafing or lifting effect is a direct result of the expanding corrosive products among the grains of the metals which forces the grains apart [9].



Figure 3: Mark II glasis plate.



Figure 4: Centurion armoured skirt.

3.5 Galvanic corrosion

Galvanic corrosion is the electrochemical reaction between two dissimilar metals in the presence of electron conductive path and the preferential corrosion of one metal more than the other [16]. This mode of corrosion was identified in the Scorpion, see Figure 5. The presence of moisture among the bolt, washer and the armoured skirt has caused this type of corrosion.

3.6 Pitting corrosion

Centurion in Figure 6 shows signs of pitting corrosion. In this case the corrosion is confined to a small point with resulting cavities in the metal. The localised phenomenon of corrosion creates holes in the metal and then penetrates inwards, deteriorating metal from the inside. The corrosion products covers the pit and creating a small hole with no significant material loss on the surface leading to a catastrophic malfunction, it is one of the severe forms of corrosion which is very difficult to detect and hard to predict the result [14, 17, 18].



Figure 5: Galvanic corrosion in scorpion.



Figure 6: Pitting in centurion.

3.7 X-ray Fluorescence of the Sherman M4A1

X-Ray fluoresce (XRF) was conducted on three points A, B, C on corroded, E, F, and G on sand blasted surfaces and point D on the cross section of the sample, see Figure 7. Table 2 shows results of the points A, B and C. On averages Fe 92.07% is the highest, second highest is the Si 5.39%, Mn 0.91% was the third highest and the lowest was Cu with a trace of 0.04%.

Figure 8 shows the graphical representation of the XRF conducted at point D where Fe 98.30% is the highest, second highest is Si 0.65%, Mn 0.63% the third highest and traces of Ti, V, Co and Mo were identified.

XRF conducted at points E, F and G on the sandblasted surface shown on averages Fe 98.12% the highest, Mn 0.66% second highest, Si 0.59% the third highest while W 0.02% the lowest and no traces of Co or V were identified. Figure 9 shows the graphical representation of the XRF analysis at point G.



Figure 7: XRF points on Sherman.

Table 2: XRF of the corroded surface of M4A1.

Vehicle Type: Sherman				
Sample- 1			Surface: Corroded	
Time duration: 30 seconds			MQ for points: A= 5.70 B= 4.50 C= 4.60	
Material Standard		06 American	06 American	06 American
Constituents %		A- Reading 254	B-Reading 255	C-Reading 256
1	Si	4.89	5.92	5.38
2	P	0.46	0.54	0.85
3	Ti	0.19	0.19	0.2
4	V	0.05	0.05	0.05
5	Cr	0.11	0.08	0.09
6	Mn	0.86	1.11	0.78
7	Fe	92.68	91.48	92.05
8	Co	0.21	0.22	0.12
9	Ni	0.06	0.08	0.1
10	Cu	0.05	0.03	0.04
11	Mo	0.05	0.06	0.06
12	W	0.33	0.2	0.12

3.8 Pulse echo ultrasonic scanning

Pulse Echo scanning was conducted on the Sherman M4A1 with a probe of 4.00 MHz twin crystal and 10.00 mm diameter using 0.25 MHz Hi pass filter and 10.00 MHz low pass filter frequencies with a probe delay of 7.630 μ S. Compression waves with a velocity of 5903.00 M/sec are used to scan a total area of 174.00 mm length with 6.040 pulses/mm and 68.00 mm width with 3.580 pulses/mm mapping material loss every 2.00 mm on the sample.

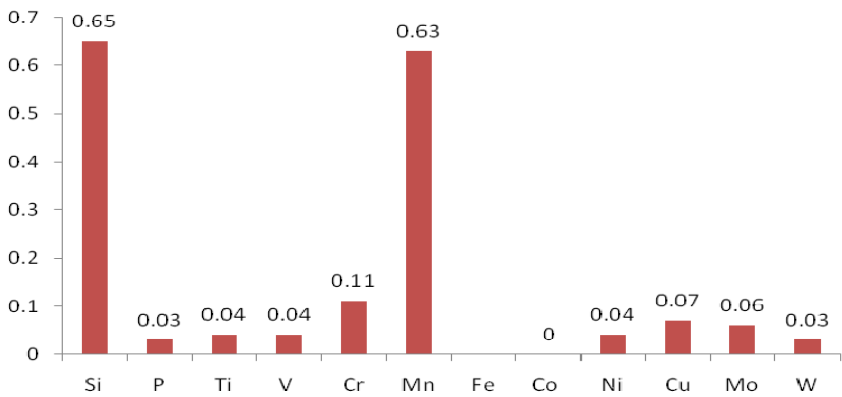


Figure 8: XRF analysis of point D, No Fe (98.30%) included.

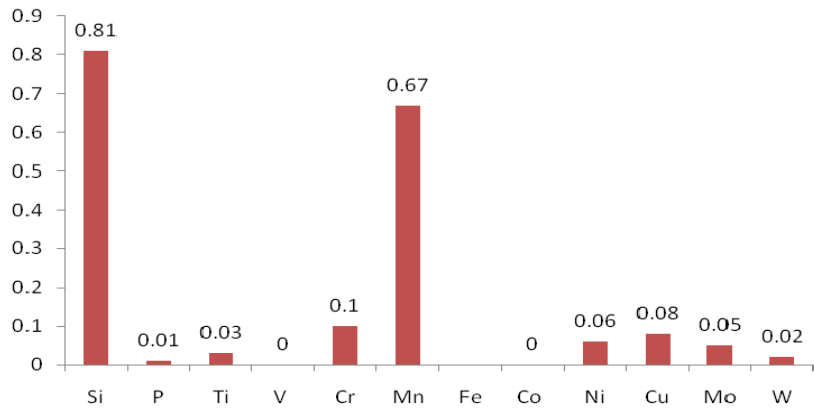


Figure 9: XRF analysis of point G, No Fe (98.09%) included.

Figure 10 shows the end views and the c-scan of the sample with implementation of colour coding Red for 0.00 mm and Blue for 10.00 mm. Two cursors Red and Blue show the X-axis, Y-axis location and the corresponding depths of the particular points on the sample.

A user defined area is taken for finding the maximum and minimum thicknesses starting at 2.00 mm on the X-axis, 2.00 mm on the Y-axis in Figure 11 and finishing at 172.00 mm on the x-axis and 66.00 mm at the y-axis in Figure 12 respectively to avoid any distortion in signals at the edges. The scan detected maximum remaining thickness of 9.80 mm at horizontal position of 150.00 mm and vertical position of 26.00 mm with a drastic loss in material to a minimum of 4.60 mm at horizontal position of 28.00 mm and vertical position of 8.00 mm. The maximum thickness of 9.80 mm is recorded at two different points. The second lowest depth is 4.70 mm and is detected at seven different



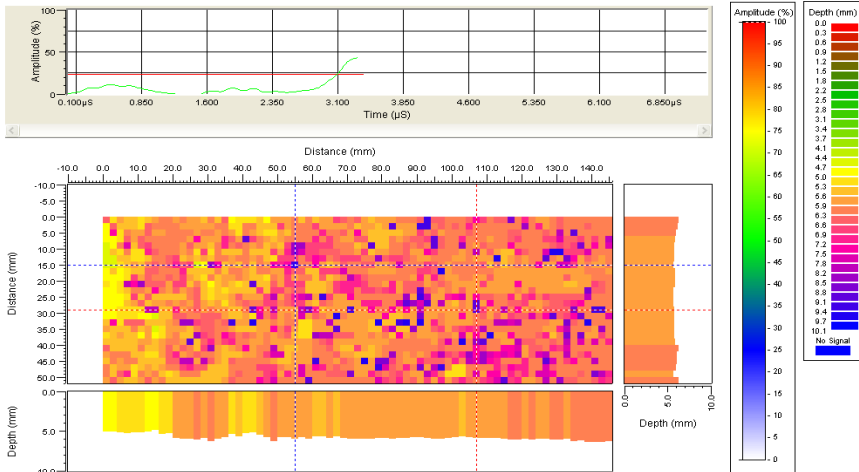


Figure 10: Pulse echo scan of M4A1.

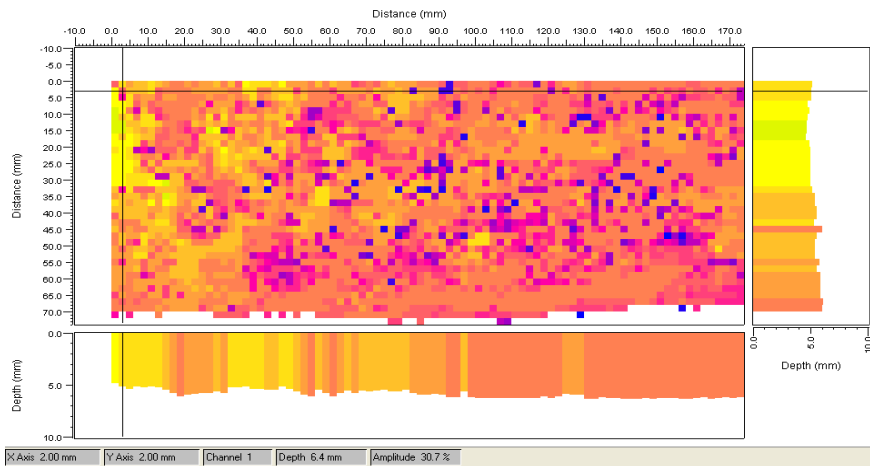


Figure 11: User defined area starting at 2.00 mm on x-axis and 2.00 at y-axis.

positions; third lowest of 4.80 mm at six various points and the remaining thickness of 4.90 mm are recorded at four different points in the samples. The minimum remaining thickness of 4.60 mm is recorded at three different points.

4 Discussion

The modes of corrosion identified above can be retarded by using the protective measures such as coatings and paint for uniform corrosion, application of lubrication and exclusion of air in the fretting corrosion, alleviating the stress in stress corrosion cracking, using same metal types in galvanic or applying insulation between two different metals.

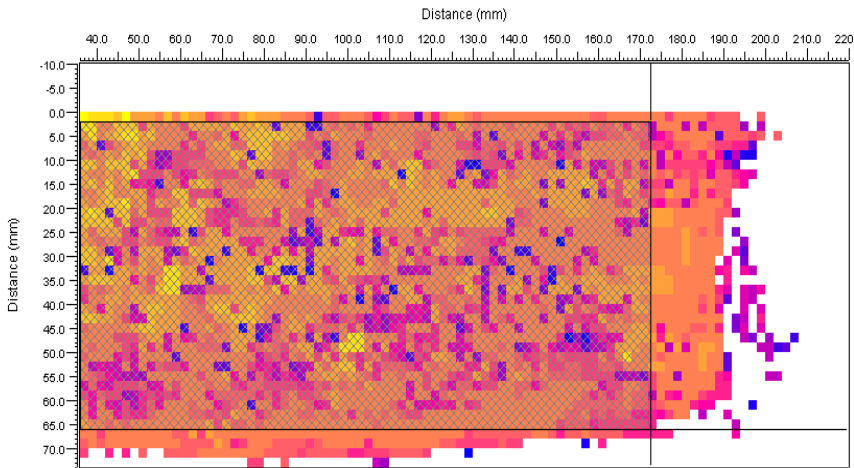


Figure 12: User defined area finishing at 174 mm on x-axis and 66 on y-axis.

The alloying elements such as Mn, Cr, V W and Mo identified though XRF are used as hardening agents to improve hardness, ductility and tensile strength [19]. Also Mo, Mn and P are used for the rust and corrosion prevention. Mo is used in high strength alloys and super alloys for strength and wear resistance [20].

Sherman M4A1 was designed by Lima Locomotive Works in the United States. At the time of manufacture the armoured thickness range was kept between maximum of 62.00 mm and a minimum of 12.00 mm [21, 22]. However it is not practical to follow any possible modification in the armour thickness and because of this reason the highest thickness recorded in the scan is considered the maximum thickness. During the service life, exposure to extreme environments has led to the deterioration and material loss. The ultrasonic scan of has shown a remarkable material loss of 5.20 mm between the maximum remaining thickness of 9.80 mm and the minimum remaining thickness of 4.60 mm. Currently in the museum collection, the Sherman travels between two controlled and uncontrolled environments. Varying environments and the likelihood of failing protective measures, temperature fluctuations, humidity ratio variations, rain water and the extent of chemical reaction etc will influence the rate of corrosion and in the controlled environment corrosion residues from may result in indoor atmospheric corrosion [23, 24].

5 Conclusion

The research work uses a conventional method of analysing corrosion through surveying vehicles in the museum environment which is followed by novel methods of XRF for the elemental identification and Ultrasonic scanning to measure and map corrosion. Research work will be conducted for corrosion

modelling and for the life expectancy of large historic vehicles based upon the results from this research work in order to maximise the longevity, durability and reliability.

Acknowledgements

The authors would like to thank Mark Nel, Mark Clark in AGR, Jon Previtt West-Dean College and Mike Hayton in The Tank Museum Bovington for their in kind support during this research work.

References

- [1] M. Colavita, "Service Life and Aging of Military Equipment," *Corrosion: Environments and Industries (ASM Handbook)*, vol. 13C, pp. 220-228, 2006.
- [2] A. S. Vinod, "Corrosion in the Military," presented at the Corrosion: Environments and Industries (ASM International), 2006.
- [3] Z. Ahmad, "Basic Concepts in Corrosion," in *Principles of Corrosion Engineering and Corrosion Control*, Oxford: Butterworth-Heinemann, 2006, pp. 9-56.
- [4] I. C. Handsy and J. Repp, "Ground Vehicle Corrosion," *Corrosion: Environments and Industries (ASM Handbook)*, vol. 13C, pp. 148-150, 2006.
- [5] M. T. Gudze and R. E. Melchers, "Operational based corrosion analysis in naval ships," *Corrosion Science*, vol. 50, pp. 3296-3307, 2008.
- [6] B. Beckhoff, *Handbook of practical X-ray fluorescence analysis*. Berlin; London: Springer, 2006.
- [7] R. v. Grieken and A. A. Markowicz, *Handbook of X-ray spectrometry*, 2nd ed., rev. and expanded. ed. New York, N.Y.: M. Dekker, 2002.
- [8] J. C. Drury, *Ultrasonic flaw detection for technicians*, 3rd ed. [Swansea]: Silverwing Ltd., 2004.
- [9] R. Baboian, *Corrosion tests and standards : application and interpretation*. Philadelphia, Pa.: ASTM, 1995.
- [10] H. H. Uhlig and R. W. Revie, *Corrosion and corrosion control : an introduction to corrosion science and engineering*, 4th ed. / R. Winston Revie. ed. Hoboken, N.J.: Wiley-Interscience; Chichester: John Wiley [distributor], 2008.
- [11] R. C. Bill, "The role of oxidation in the fretting wear process," 1981.
- [12] A. Neyman and O. Olszewski, "Research on fretting wear dependence of hardness ratio and friction coefficient of fretted couple," *Wear*, vol. 162-164, pp. 939-943, 1993.
- [13] R. P. M. Procter, *et al.*, "Stress-corrosion cracking of C---Mn steels in methanol-ammonia environments--I. Effects of environmental and mechanical variables," *Corrosion Science*, vol. 33, pp. 1009-1031, 1992.
- [14] R. C. Newman, "Stress Corrosion Cracking," in *Shreir's Corrosion*, J. A. R. Tony, Ed., Oxford: Elsevier, 2010, pp. 864-901.



- [15] C. A. e. Hampel, *The encyclopedia of electrochemistry*. NY: [s.n.], 1964.
- [16] H. P. Hack, "Galvanic Corrosion," in *Shreir's Corrosion*, J. A. R. Tony, Ed., Oxford: Elsevier, 2010, pp. 828-856.
- [17] Z. Szklarska-Smialowska, *Pitting corrosion of metals*. Houston, Tex.: National Association of Corrosion Engineers, 1986.
- [18] R. Baboian, "Automotive corrosion tests and standards," 1996.
- [19] M. F. Ashby and D. R. H. Jones, *Engineering materials 2 : an introduction to microstructures, processing and design*, 3rd ed. Oxford: Butterworth-Heinemann, 2006.
- [20] F. F. Schmidt, *The engineering properties of molybdenum and molybdenum alloys*. Columbus, Ohio: Defense Metals Information Center, 1963.
- [21] P. Chamberlain and C. Ellis, *British and American tanks of World War II: the complete illustrated history of British, American, and Commonwealth tanks, 1939-1945*. London New York: Cassell & Co. ;Distributed in the USA by Sterling Pub., 2000.
- [22] R. Jackson, *Tanks : and armoured fighting vehicles*. Bath: Parragon, 2007.
- [23] A. R. Mendoza and F. Corvo, "Outdoor and indoor atmospheric corrosion of non-ferrous metals," *Corrosion Science*, vol. 42, pp. 1123-1147, 2000.
- [24] I. Odnevall and C. Leygraf, "The formation of $\text{Zn}_4\text{Cl}_2(\text{OH})_4\text{SO}_4 \cdot 5\text{H}_2\text{O}$ in an urban and an industrial atmosphere," *Corrosion Science*, vol. 36, pp. 1551-1559, 1994.